


Sketch #5 Overhead secondary service drop attachment to customer-owned service and meter pole for overhead distribution

PPL FURNISHES, INSTALLS, MAINTAINS:

1. SERVICE DROP AND MAKES CONNECTION TO CUSTOMER'S SERVICE ENTRANCE CONDUCTORS. MAXIMUM TENSION - 850 LBS.
2. METER.

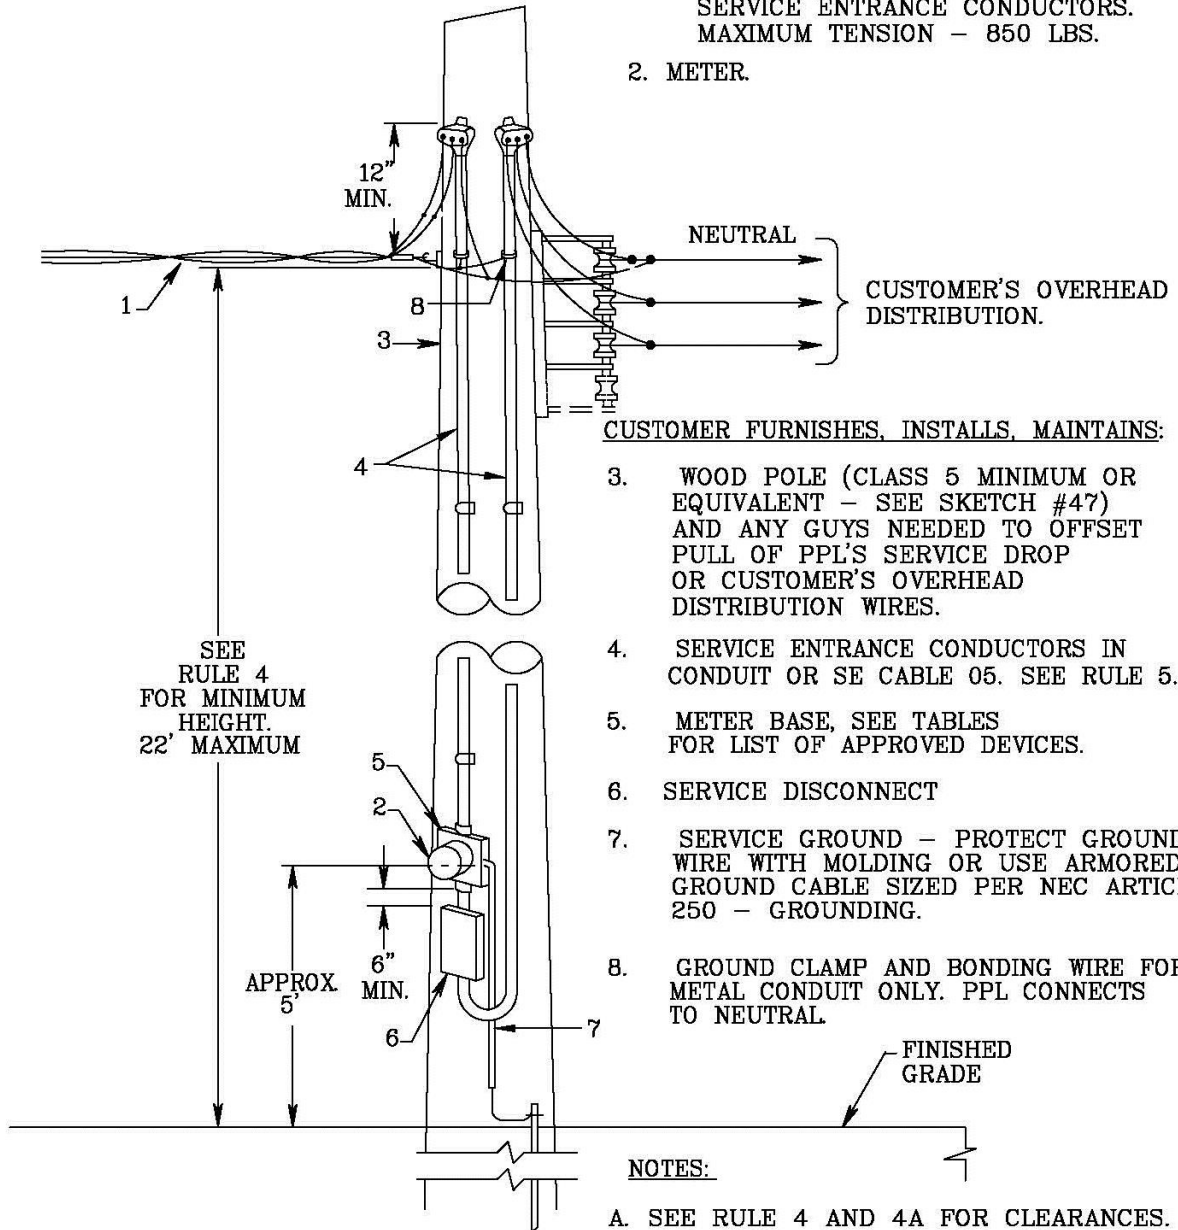

CUSTOMER FURNISHES, INSTALLS, MAINTAINS:

3. WOOD POLE (CLASS 5 MINIMUM OR EQUIVALENT - SEE SKETCH #47) AND ANY GUYS NEEDED TO OFFSET PULL OF PPL'S SERVICE DROP OR CUSTOMER'S OVERHEAD DISTRIBUTION WIRES.
4. SERVICE ENTRANCE CONDUCTORS IN CONDUIT OR SE CABLE 05. SEE RULE 5.
5. METER BASE, SEE TABLES FOR LIST OF APPROVED DEVICES.
6. SERVICE DISCONNECT
7. SERVICE GROUND - PROTECT GROUND WIRE WITH MOLDING OR USE ARMORED GROUND CABLE SIZED PER NEC ARTICLE 250 - GROUNDING.
8. GROUND CLAMP AND BONDING WIRE FOR METAL CONDUIT ONLY. PPL CONNECTS TO NEUTRAL.

NOTES:

- A. SEE RULE 4 AND 4A FOR CLEARANCES.

<p>RULES FOR ELECTRIC METER AND SERVICE INSTALLATIONS PPL ELECTRIC UTILITIES CORPORATION</p>	<p>Rules: 4, 4A, 5 REMSL_S005..dwg Date: 7/18/16 Engr: NAP</p>
--	---